



Survey Report on: Netherlee,
Deerness,
KW17 2QH.

Client: Gordon Bryan.

Client address: 48 Charleston View,
Inverness,
IV3 8SX.

Date of inspection: 29th October 2020.

Prepared by: Stephen J Omand, F.R.I.C.S.,
Chartered Valuation Surveyor,
R.I.C.S. Registered Valuer.

SERVICES INCLUDE:

Bank &
Building
Society
Valuations

Residential &
Commercial
Property Surveys

Single
Surveys

Energy
Performance
Certificates

SAP
Certifications

Building
Surveying
Services

Rental &
Insurance
Valuations

Residential
& Commercial
Plans

Title Deed
Plans

Overseeing
New Builds

Planning
& Building
Warrant
Applications

A list of partners is available at the above address

LOCAL KNOWLEDGE ■ NATIONAL COVERAGE

Offices throughout Scotland

Each member firm of First Surveyors Scotland is an independent entity and no partnership implies or otherwise exists between the firms by reason of their membership of First Surveyors Scotland. First Surveyors Scotland is the trading name of First Surveyors Scotland Limited a company registered in Scotland Company No 201050. Registered Office: 57 Albany Street, Edinburgh, EH1 3QY



1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. were not inspected or reported on.

Description	1½ storey detached house.
Accommodation	Ground floor- Entrance, Kitchen, Sitting Room, 3 Bedrooms, one with En Suite and Bathroom. First Floor- Sitting Area, 4 Bedrooms and Shower-room.
Gross external floor area (m²)	Ground Floor- 103.70m ² . First Floor- 90.90m ² .
Neighbourhood and location	Situated in the rural parish of Deerness.
Age	Circa 1996.
Weather	Dry and bright.
Chimney stacks	<i>Visually inspected with the aid of binoculars where appropriate.</i> Single, system-built chimney stack.

Roofing including roof space

Sloping roofs were visually inspected with the aid of binoculars where appropriate.
Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Pitched roof clad concrete tiles off underfelt, sarking plywood and roof timbers, with timber faciaboards.

Rainwater fittings

Visually inspected with the aid of binoculars where appropriate.

P.V.C. gutters and downpipes.

Main walls

Visually inspected with the aid of binoculars where appropriate.
Foundations and concealed parts were not exposed or inspected.

Norwegian, Fjogstad timber frame house clad with weatherboarding. A number of these houses were erected in Orkney in the past, but this ceased a few years ago, when the builder supplying and erecting them retired.

Windows, external doors and joinery

External doors were opened and closed where keys were available.
Random windows were opened and closed where possible.
Doors and windows were not forced open.

Double glazed timber doors and windows.

External decorations

Visually inspected.

Treatment to all timber.

Conservatories / porches

Visually inspected.

No conservatories or porches.

Communal areas

Visually inspected.

Shared access track off public road.

Garages and permanent outbuildings

Visually inspected.

Concrete block garage, with lean-to “greenhouse” with tiled roof, as for house, concrete floor, single and double glazed timber windows and timber up and over door.
Small basic timber garden shed and concrete block coal bunker.

Outside areas and boundaries

Visually inspected.

Boundaries defined by agricultural type fencing. Unsurfaced shared access track, off public road, timber steps to front door, timber balcony to rear elevation.

Ceilings

Visually inspected from floor level.

Fjogstad tiled ground floor ceilings, plasterboard lined first floor ceilings.

Internal walls

Visually inspected from floor level.
Using a moisture meter, walls were randomly tested for dampness where considered appropriate.

Plasterboard linings to walls, timber stud partitions lined plasterboard.

Floors including sub floors

Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.

Suspended timber floors.

Internal joinery and kitchen fittings

Built-in cupboards were looked into but no stored items were moved.
Kitchen units were visually inspected excluding appliances.

Timber doors, finishes and stairs, all of typical Fjogstad design.

Chimney breasts and fireplaces

Visually inspected. No testing of the flues or fittings was carried out.

Solid fuel stove to sitting room, with brick surround and tiled hearth. Plasterboard lined chimney breast.

Internal decorations

Visually inspected.

Emulsioned walls and first floor ceilings with varnished finishes.

Cellars

Visually inspected.

There are no cellars.

Electricity

Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Mains electricity supply. There is a Roolec charging point and solar panels to the south facing roof slope.

Gas

Visually inspected.

No mains gas in Orkney. Bottled supply for cooking.

Water, plumbing and bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.

Mains water supply.
Ground floor bathroom of plastic bath, with mixer shower taps, toilet and basin.
Ground floor en suite of shower, with mixer shower, toilet and basin.
First floor shower-room of shower, with mixer shower, basin and toilet.
Kitchen- Flush sink.

Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.

Air source heating supplying internal air to air unit, Gravity fed single radiator to first floor off stove, foam lagged hot water cylinder with immersion. Electric towel rails.

Drainage

Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.

Private drainage to septic tank.

Fire, smoke and burglar alarms

Visually inspected. No tests whatsoever were carried out to the system or appliances.

Various smoke detectors. Mechanical ventilation system. Solar panels to south facing slope.

Any additional limits to inspection:


There was no access for inspection to the foundations, to the timber frame construction, to behind side wall linings, to the underside of floors or to the floor construction. Only the upper part of the hot water cylinder was open to restricted inspection. Fitted coverings prevented access to floor surfaces. The efficiency or condition of the heating system, drainage system, mechanical ventilation system, Rolec charging point or solar panels cannot be commented upon.

Tests by the Health Protection Agency have identified some properties in this area as having natural levels of Radon Gas in excess of those normally considered acceptable. Further advice on this should be obtained from the Health Protection Agency. Telephone 01235 822745/876/737.

An inspection for Japanese Knotweed or other invasive plant species was not carried out and unless otherwise stated, for the purposes of this report, it is assumed that there is no Japanese Knotweed or other invasive plant species within the boundaries of the property or in neighbouring properties.

It is out with the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.

Sectional diagram showing elements of a typical house

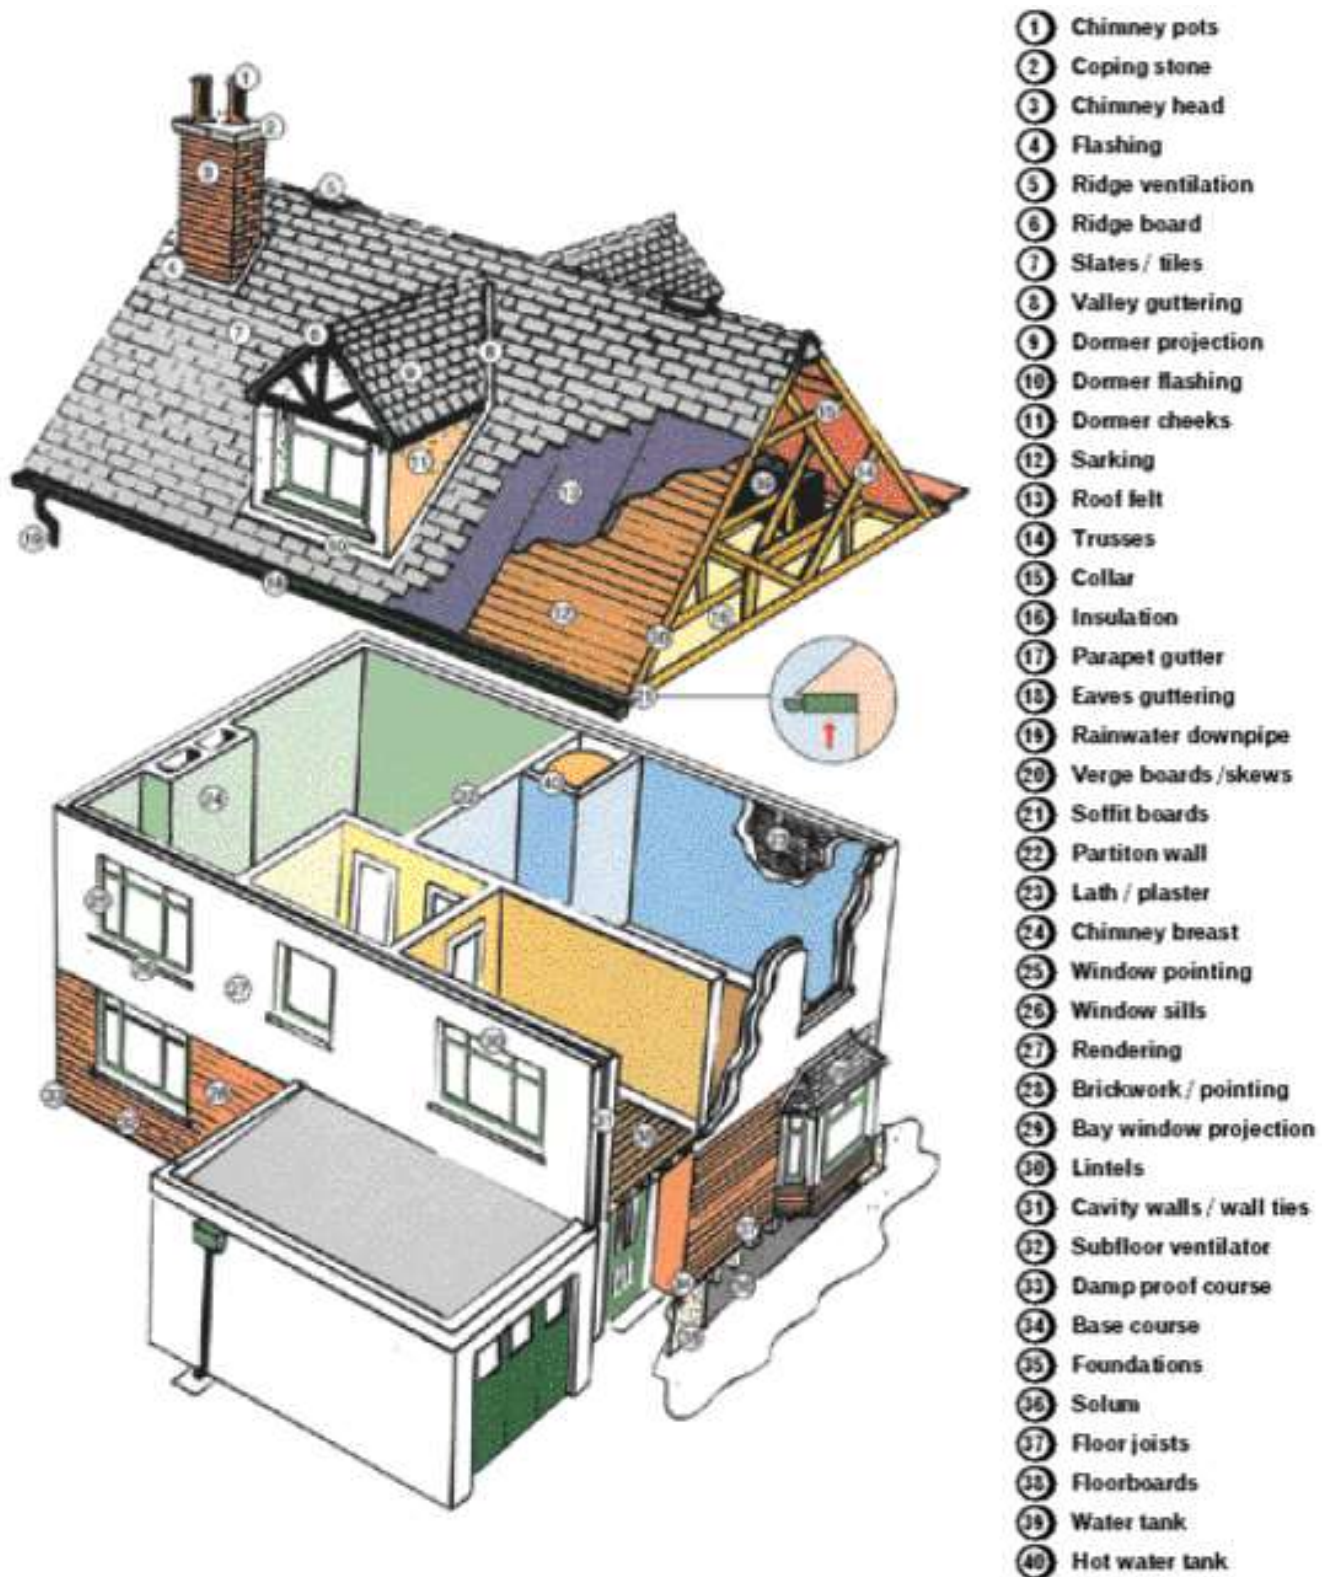















Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.








2. CONDITION




This section identifies problems and tells you about the urgency of any repairs by using one of three categories.

<p>Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</p>	<p>Category 2: Repairs or replacement requiring future attention, but estimates are still advised.</p>	<p>Category 1: No immediate action or repair is needed.</p>
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-------------------------------------------------------------------------------------------------------------------	------------------------------------------------------------------------

 <p>Structural movement</p>	
Repair category	1
Notes:	There was no evidence of significant subsidence, settlement or cracking to the main walls.
 <p>Dampness, rot and infestation</p>	
Repair category	3
Notes:	Wet rot was noted to the balcony and steps
 <p>Chimney stacks</p>	
Repair category:	2
Notes:	The chimney stack is scratch coated only and the pot is cracked.
 <p>Roofing including roof space</p>	
Repair category:	1
Notes:	There is moss to the roof surface.
 <p>Rainwater fittings</p>	
Repair category:	1
Notes:	The rainwater fittings require cleaning and there is a loose bracket to a front downpipe. The condition or efficiency of the system cannot be commented upon, as it was not raining at the time of inspection.
 <p>Main walls</p>	
Repair category:	1
Notes:	Walls appear sound for their age. See comments under "External Decoration".

 Windows, external doors and joinery	
Repair category:	2
Notes:	There is some moss to windows and surfaces are quite weathered. The door lock cover and handles are tarnished. See comments under "External Decoration".
 External decorations	
Repair category:	2
Notes:	All exterior timber requires full re-decoration.
 Conservatories / porches	
Repair category:	N/A
Notes:	
 Communal areas	
Repair category:	1
Notes:	Confirm ownership and shared responsibility for upkeep of the access track.
 Garages and permanent outbuildings	
Repair category:	3
Notes:	The garage is of an age where it requires an amount of repair and maintenance. Windows and doors should, ideally, be replaced. The up and over door could not be opened. The shed is in poor condition.
 Outside areas and boundaries	
Repair category:	3
Notes:	The one side of the handrail at the front door is opening up from the newel post and the steps are starting to rot. The steps to the balcony are rotten. Both areas will require attention.
 Ceilings	
Repair category:	1
Notes:	Some split seams evident.
 Internal walls	
Repair category:	1
Notes:	Walls are satisfactory for their age.

 Floors including sub-floors	
Repair category:	1
Notes:	Floors feel sound when walked upon.
 Internal joinery and kitchen fittings	
Repair category:	1
Notes:	Internal joinery is generally satisfactory for its age. Some mitre joints to finishes are quite open. There is slight movement in the landing handrail.
 Chimney breasts and fireplaces	
Repair category:	2
Notes:	Some corrosion was noted to the stove. Per the owner the stove heats the radiator to the first floor. The condition or efficiency of the flue or the stove cannot be commented upon.
 Internal decorations	
Repair category:	2
Notes:	An amount of redecoration will be required. It was noted that some nail holes to finishes have not been punched and filled.
 Cellars	
Repair category:	N/A
Notes:	
 Electricity	
Repair category:	1
Notes:	There is an open vent to the lower, outer wall of the first floor shower-room and the cover to one ceiling rose is loose. The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.
 Gas	
Repair category:	1
Notes:	In the interest of safety all gas appliances should be checked by a Gas Safe Registered Engineer.

 Water, plumbing and bathroom fittings	
Repair category:	2
Notes:	The shower tray to the shower-room is chipped.
 Heating and hot water	
Repair category:	1
Notes:	<p>The condition or efficiency of the heating systems cannot be commented upon.</p> <p>The heating and hot water systems should be periodically tested by a qualified engineer, in accordance with the manufacturer's requirements, and any recommendations implemented.</p>
 Drainage	
Repair category:	1
Notes:	The condition or efficiency of the drainage system cannot be commented upon.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	N/A
Communal areas	1
Garages and permanent outbuildings	3
Outside areas and boundaries	3
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	N/A
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Repair Categories

Category 3:

Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2:

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1:

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes: Parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Confirm

- 1- Site boundaries.
- 2- That the septic tank is registered with S.E.P.A.
- 3- That Local Authority Completion Certificates have been issued in respect of any works for which Building Warrant was required or obtained.
- 4- The position re the charge point and the solar panels.

Estimated re-instatement cost for insurance purposes


£360,000.

Valuation and market comments

Two hundred and sixty five thousand pounds, £265,000.

Report author: Stephen J Omand, F.R.I.C.S.,
Chartered Valuation Surveyor,
R.I.C.S. Registered Valuer.

Address: 14 Victoria Street,
Kirkwall,
KW15 1DN.

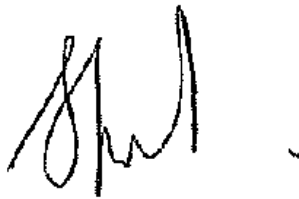

Signed:

Date of report: 10th November 2020.

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. √

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid.

Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the Surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;

TERMS AND CONDITIONS – WITH MVR – SEPTEMBER 2009

- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

TERMS AND CONDITIONS – WITH MVR – SEPTEMBER 2009

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property